

# NIGHT INCIDENT



## Report

Site

Barcelona

Date and time

2024-07-30 06:05

Attended

Phone

Site

Department

Engineering

Scope

Yes

No

System

Synthesizers - FASTLAB2DUO

System description

Describe the incident

Technicians told me that we had three modules which are not passing the cassette test.

Solved?

Yes

No

Derived?

Yes

No

To whom?

Yes - Site manager

Yes - Production manager

Yes - QA

Yes - QC

Yes - QP

Others

Who is other?

Production affected?

No

Yes - Totally cancelled

Yes - Partially cancelled

Yes - Delayed

Any comment?

Two of the modules were having a leak of vacuum because of the one way valve on the waste bottle (ING recent modification)

If possible, describe the solution

This two modules were fixed by putting cap after the one way valve. The third was having a problem with the vacuum sensor on the N2 pressure block so it was replaced but PR couldn't use it that day.

If possible, describe the root cause

Wear of the one way valve and failure of the vacuum sensor

TotalTimeOfIntervention

240.0